

ecology and environment, inc.

REM/FIT  
SITE SAFETY PLAN

## A. GENERAL INFORMATION

SITE: Enviro Chem Corp. CH2M HILL NO.: W 65230-C3

LOCATION: Zionsville, Indiana (U.S. Route 421)

PLAN PREPARED BY: Peter J. Gorton DATE: 4/30/84

APPROVED BY: [Signature] DATE: 5/2/84

OBJECTIVE(S): Sample soils via hand auger to a depth of 2 feet at 200 locations. (Approximately 50 in old drum area, and the remainder near the concrete pad, on the berm and the off-site perimeter.) Also OVA-GC injection for total organics off soils headspace.

PROPOSED DATE OF INVESTIGATION: Week of May 7th

BACKGROUND REVIEW: Complete:        Preliminary: X

DOCUMENTATION/SUMMARY: Overall Hazard: Serious:        Moderate: X

Low: X Unknown:       

## B. SITE/WASTE CHARACTERISTICS

WASTE TYPE(S): Liquid X Solid X Sludge X Gas       

CHARACTERISTIC(S): Corrosive X Ignitable X Radioactive        Volatile X

Toxic X Reactive X Unknown X Other (Name) Fungi (unknowns)

FACILITY DESCRIPTION: Inactive waste storage and recycling facility for solvents and oils from various sources.

Principal Disposal Method (type and location): Waste storage in drums, tanks, pond and solidification.

Unusual Features (dike integrity, power lines, terrain, etc.): Drums and horizontal tanks have been removed recently. Vertical tanks have been emptied. The solidification area should be cleaned up by project start date. The cooling water pond has been pumped out a number of times.

Status: (active, inactive, unknown) Inactive (recent cleanup work and possible concurrent cleanup.

History: (worker or non-worker injury; complaints from public; previous agency action): Facility operated from 9/77 to 5/82. On-site cooling water pond of 1 x 10<sub>6</sub> gal. Overflowed into Eagle Creek, which is tributary to a drinking water reservoir. History of groundwater contamination with 1,1,1-TCE, 1,2 Dichloroethane, and PCBs. EPA and IAT conducted site inspection 1982. Odors noted from cooling water. CH2M Hill Ramp visit during May 1983, remedial work conducted 7/83-8/83. Cleanup contractor has recently removed drums and some tanks. Other tanks are empty.

C. HAZARD EVALUATION

Refer to Attachment A

D. SITE SAFETY WORK PLAN

PERIMETER ESTABLISHMENT: Map/Sketch Attached? Yes Site Secured? Yes

Perimeter Identified? Yes Zone(s) of Contamination Identified? \*

\*Soil sampling will attempt to verify zone of soil contamination.

PERSONAL PROTECTION:

Level of Protection: A      B      C X D X

Modifications: Refer to Attachment B.

Surveillance Equipment and Materials: Wind direction indicator (i.e., surveying  
tape) O<sub>2</sub>/explosimeter, OVA and/or HNU with 11.7 ev and 10.2 ev lamp, TLD badges,  
monitox cyanide detector, mini rad-alert monitor. Dust suppression instrumentation  
OVA with strip chart and syringes for total organic headspace determination.

## ATTACHMENT A

### Hazard Evaluation

A cleanup contractor has recently removed all drums and the tank cars that existed on-site. Also the vertical storage tanks have been emptied and the cooling water pond has been pumped out multiple times. However, significant soil contamination was evident during previous visual inspections due to drum leakage, spills, and facility operations. Cleanup operations may have caused additional spillage of drum and tank contents.

Previously reported wastes known to be associated with this site include: cyanides, heavy metals, chlorinated solvents, polynuclear aromatic hydrocarbons, phenols, waste oils, unknown wastes, and other chemical miscellany. A new list of chemical contents data may have been generated during the tank and drum removal and if available, should be reviewed by the Project Manager and Site Safety Officer prior to on-site activities. A list of previously reported data is attached.

Exposure hazards exist via the inhalation, ingestion, and dermal contact from the wastes listed above.

Other potential health hazards exist due to the various fatigue factors associated with wearing protection equipment, the work being done on the site, and the work schedule.

Heat stress, fatigue, cramps, or exhaustion may also become a factor of personnel safety. All personnel should be made aware of physical signs, symptoms, and treatment techniques associated with each of these conditions. Work schedules may need to be adjusted accordingly if the factors of heat stress become apparent. All personnel should be encouraged to increase their intake of water during breaks and should avoid the intake of diuretics such as coffee, tea,

colas, or other caffeinated liquids. The use of salt tablets is not encouraged. Refer to the attached heat stress monitoring method.

The entire site should be considered hazardous. Specific hazardous areas on-site include:

1. The cooling water pond and surrounding area;
2. The solidification pit;
3. Areas of pooled standing water in the vicinity of where the drums were;
4. On-site building;
5. Areas where cleanup and drum removal has taken place; and
6. The concrete pad area.

Strict contamination avoidance practices should be adhered to at all times.

#### Overall Hazard Potential

On-Site. Moderate respiratory and dermal hazard due to task objectives, previous site practices, and recent cleanup operations.

Off-Site. Low, however, the following areas are of greater concern:

- o Downgradient of site,
- o Drainage areas, and
- o Site egress and entry points.

These quantities are estimates based on incomplete information.

Materials processed at ECC during its recovery/reclamation/brokering operations are listed in Table 2-1. Descriptions of these materials are presented in Table 2-2.

### 2.3.1 Bulk Storage Tanks

The bulk storage tanks are located mainly in the northern portion of the site surrounding the process building (see Figure 2-3). Known individual bulk tank storage volumes vary from 1,000 to 30,000 gallons. Table 2-3 is a partial bulk tank inventory. Bulk tank locations are identified in Figure 2-4. Of the remaining 19 tanks, at least 5 are tanker trucks that have been parked onsite. There are reportedly two buried tanks onsite.

Available test data indicate that sampling and analysis of the bulk storage tanks has been limited to one sample of a boiler fuel tank taken on May 6, 1980 by the ISBH. The fuel was composed of the following compounds:

Octane	6.2%
Acetone	13.3%
1,1,1-trichloroethane	1.6%
Methyl Ethyl Ketone	13.7%
Trichloroethylene	1.3%
Methyl Iso-butyl Ketone	3.0%
Toluene	18.4%
P-xylene	5.6%
M-xylene	20%
O-xylene	4.4%

Analysis for heavy metals found the following:

Cadmium	less than 1 ug/l
Chromium	25 ug/l
Lead	74 ug/l
Nickel	4 ug/l
Zinc	179 ug/l

### 2.3.2 Fifty-five Gallon Drums

Fifty-five gallon drums are stored in the north and south drum storage areas, generally stacked three to four high (see Figure 2-3). An inventory of drums was conducted on November 25, 1981, 6 months before the site was closed. Results of the inventory are shown in Table 2-4.

Sampling and analysis of drums has not been undertaken. The majority of drums, however, are reportedly labeled and manifested according to RCRA regulations. An ECC inventory of

Table 2-1  
MATERIALS PROCESSED AT ECC

MATERIAL	PROCESS METHOD			ULTIMATE DISPOSAL		
	<u>Distillation<sup>a</sup></u>	<u>BTU Recovery</u>	<u>Fixation<sup>b</sup></u>	<u>Distillates For Sale<sup>c</sup></u>	<u>Incineration</u>	<u>Landfill</u>
<b>RECOVERABLE LIQUIDS</b>						
Lacquer Thinner	X			X		
Paint Solvents	X			X		
Washup Thinner	X			X		
Chlorinated Solvents	X			X		
Ink Solvents	X			X		
Still Bottoms		X			X	
Scrap Paint		X			X	
Paint Resins and Pigments		X			X	
Scrap Glue		X			X	
Resin Additive		X			X	
Scrap Oil		X			X	
<b>NONRECOVERABLE SOLIDS</b>						
Paint Filters			X			X
Paint Solids			X			X
Vinyl Residues			X			X
Paint Booth Overspray Waste			X			X
Metal Hydroxide Sludges			X			X
Drum Bottoms			X			X
Settled Solids from Distillation			X			X

<sup>a</sup> Distillation on thin film unit.

<sup>b</sup> Fixation with sand, calcium, oxide, kitty litter or fly ash.

<sup>c</sup> Distillates sold, still bottoms disposed at secure landfill.

Source: ECC Records.

GLT90/16

Table 2-2 (page 1 of 2)

DESCRIPTIONS OF MATERIALS PROCESSED AT ECC

RECOVERABLE LIQUIDS

Lacquer thinner - A mixture of solvents composed of members of the ketone and acetate families used to dilute lacquers for coating surfaces.

Paint Solvent - Specific industrial solvents such as methyl ethyl ketone, toluene, xylene, etc., used in industries to thin paint, speed up or reduce drying time, etc.

Washup thinner - Mixtures of flammable solvents used to strip paint from spray guns, machine parts, etc.

Chlorinated solvents - Mixtures of nonflammable solvents such as tetrachloroethylene, methylene chloride, and trichloroethylene that are generally used for degreasing metals in industry.

Ink solvents - Mixtures of flammable solvents composed of members of the acetate and alcohol families used to remove dyes and inks in the printing industries.

Still bottoms - The remaining portion (sludge) of a material that has been processed on a distillation unit.

Scrap Paint - Outdated paint, paint that has been made incorrectly, or paint that will not meet a customer's needs.

Paint Resins & Pigments - Outdated resins and pigments used in the production of latex and enamel paints that will no longer meet quality standards.

Scrap Glue - Outdated glue, glue that has been made incorrectly or will not meet a customer's needs.

Resin additives - Plasticizers (nonvolatile compounds) and dispersion agents.

Scrap Oil - Used oils that have been contaminated with water, dirt, metal shavings, etc.

NONRECOVERABLE SOLIDS

Paint Fillers - Spent filters that have been contaminated beyond use.

Paint Solids - Solids that have settled out of old paint and will not disperse back into the paint solution.

Table 2-2 (page 2 of 2)

Vinyl residues - Old vinyl resins that have hardened due to evaporation of solvents from the original mixture.

Overspray paint booth waste - A solid waste that consists of reacted, film-forming paint that has been scraped from a paint spraying process.

Metal hydroxide sludges - Sludges from the plating industry that contain metals tied to hydroxide groups.

Source: ECC Records.

GLT/90/21



## ATTACHMENT B

### LEVEL OF PROTECTION

#### On-Site Soil Boring and Sampling

On-site work will require Level C protection with the ability to upgrade to Level B. On-site areas known or suspected to be contaminated and not being sampled should be strictly avoided (i.e., visually discolored soils and ponded water, storage tanks, and covered and open lagoons). The site shall be entered from an upwind location if possible with continuous monitoring. The potential for levels of known and unknown volatile and particulate contaminants above those previously measured are possible, especially during subsurface soil sampling. Therefore, continuous monitoring with an OVA and/or HNU, O<sub>2</sub>/explosimeter, and other surveillance equipment is required. Dust suppression is recommended.

#### Level C Personnel Protection

- o PVC or Saranex coated Tyvek coveralls.
- o Full face (ultratwin) air purifying respirator with combination particulate/organic vapor cartridges (GMC-H).
- o Neoprene or butyl rubber gloves over surgeons gloves (taped at wrist).
- o Disposable booties over neoprene steel toe/shank boots.
- o Hard hats.

### Level B Personnel Protection

- o One (1) piece saranex/sigel coated coveralls with hood.
- o SCBA.
- o Viton and/or butyl, or neoprene gloves over surgeons gloves.
- o Disposable booties over neoprene boots.

### Action levels for the required site instruments are as follows:

- o OVA/HNU
  - o Any readings above off-site, upwind background will require Level C protection (this refers to off-site work since on-site work will be performed in Level C protection).
  - o Readings greater than 5 ppm above background will require Level B protection and may dictate revisions to work techniques.
  - o Levels greater than 5 ppm dictates immediate site evacuation and reevaluation of work activities by the SPM and SSC.
- o Explosive meter levels greater than 50% LEL will dictate immediate site evacuation and re-evaluation of the work plan.
- o O<sub>2</sub> meter levels less than 19.5% or greater than 21% will dictate immediate evacuation and re-evaluation of the work plan.
- o Cyanide (especially hydrogen cyanide) at the OSHA PEL levels (10 ppm) and radiation detection will warrant evacuation and re-evaluation of work plan.

### Off-Site Soil Boring and Sampling

Off-site work will require a modified Level D protection initially with the ability to upgrade to Level C. Off-site areas

suspected of being contaminated should be sampled in Level C initially until a decision to downgrade to the modified Level D can be made.

A decision to downgrade to either a modified or normal Level D will be made by the site safety officer and will be based on but not limited to the following criteria:

- o Monitoring results with consideration for the limitations of the instrumentation;
- o History of task objectives area; and
- o Site conditions (i.e., windy, wet, stained soils, and odors).

#### Action Levels

- o Any instrumentation readings above background will require Level C protection.

#### Modified Level D Protection will include:

- o Tyvek disposable coveralls;
- o Neoprene gloves over surgeons gloves;
- o Disposable booties over neoprene steel toe/shank boots;
- o Hard hat with face shield; and

APR with GMC-H cartridges.

Normal Level D will include work cloths, work gloves over surgeons gloves, and steel toe/shank work boots.

#### Sample Headspace Analysis with OVA

Level D protection with two layers of surgeons gloves will be required. If syringe ingestion is not used an APR will be required.

## Heat Stress

In the levels of protection prescribed above, heat stress can be a major hazard to personnel. All individual on-site workers will be monitored for symptoms of heat stress immediately upon leaving the decon line. Appropriate actions must be taken should symptoms arise. Heat stress monitoring and avoidance techniques include:

- o Avoid consumption of caffeine-containing liquids;
- o Have water or Gatorade on hand;
- o Shift work responsibilities so that each person has a sufficient rest period;
- o Measure heart rate and body temperature frequently (per attached heat stress monitoring memo - see Browha Method).
- o Measure weight daily to insure no critical loss of fluids;
- o Buddy System is imperative; and
- o Make sure that workers consume a sufficient amount of liquids to replenish the bodies electrolytes.

DECONTAMINATION PROCEDURES: Refer to Attachment C.

Special Equipment, Facilities, or Procedures: Refer to Attachment C.

First aid kit, eye wash unit

SITE ENTRY PROCEDURES: Enter from an upwind position if possible. Avoid all possible surface contamination when possible. Buildings are not to be entered.

<u>Team Member</u>	<u>Responsibility</u>
<u>Dennis Totzke - CH2M Hill</u>	<u>Project Manager/Sampler</u>
<u>Ike Johnson - CH2M Hill</u>	<u>Sample Team Leader</u>
<u>Brad Berggren - CH2M Hill</u>	<u>Sampler/Instrument</u>
<u>Randy Weltzen - CH2M Hill</u>	<u>Surveyor/Sampler/Decon</u>
<u>Mark Lepkowski - CH2M Hill</u>	<u>Decon/Sampler/Chain of Custody</u>
<u>Don Woods - E &amp; E</u>	<u>Site Safety/OVA Headspace</u>
<u>Peter Gorton - E &amp; E</u>	<u>Site Safety/OVA Headspace</u>
<u> </u>	<u> </u>
<u> </u>	<u> </u>
<u> </u>	<u> </u>
<u> </u>	<u> </u>

WORK LIMITATIONS (Time of day, etc.): Continuous air monitoring is to be provided. Day-light hours only. Daily safety meetings in areas where there is a potential for buried drums (known/suspected), a thorough magnetometer survey will be conducted prior to boring.

INVESTIGATION-DERIVED MATERIAL DISPOSAL: Disposables will be properly bagged, labelled, and contained on-site for later disposal. Auger cuttings should be disposed of according to local, state, and EPA protocol. Decon water should be contained and later disposed of.

## ATTACHMENT C

### ON-SITE OPERATIONS

#### Site Organization

In order to create efficient and safe working conditions, access to and from the site must be controlled by delineating those areas considered as potentially hazardous and by associating certain areas of the site with certain work activities. For this purpose, a three-zone operation area, including an administrative support area ("clean"), a contamination reduction area (potentially "hot"), and an exclusion area ("hot"), will be established and approved by the site safety officer prior to commencement of work activities.

The administrative support area should be located if possible at a recommended distance of approximately 50 meters or more upwind from the contamination reduction area and upwind of all on-site contaminated areas. Personnel in this area will wear Level "D" personnel protection.

The contamination reduction area contains the personnel and equipment decontamination stations and will be located at a recommended distance of approximately 40 meters upwind of the exclusion area. Level of protection for decontamination personnel may include Levels C and B.

The exclusion area will contain the worksite and designated hazard areas. Levels of personnel protection in this area will vary depending on work function, daily on-site activity, and monitoring data, etc.

### Decontamination Procedures

A designated area will be established for personnel decontamination and equipment decontamination. Personnel and equipment decons should be separated by no less than 10 feet. The personnel decontamination area will contain at a minimum:

- o Decontamination solutions for glove, boot, and clothing;
- o Wash and rinse water;
- o Wash tubs and brushes;
- o Hand/face wash;
- o Disposable and equipment drop; and
- o Emergency first aid equipment.

All workers will be shown the correct procedures for decontamination and for changing from contaminated clothing to clean clothing. The decontamination areas will be monitored using a photoionization detector (PID) or flame ionization detector (FID) on a periodic basis to insure that this area does not become overly contaminated.

The recommended list of equipment and sample decon is minimally as follows:

- o Steam cleaner (optional);
- o Solvents (APR's must be worn during solvent decon);
- o Wash solutions and water rinse (DI or organic free water is recommended);
- o Collection tubs/basins; and
- o Plastic sheeting.

\*EMERGENCY TELEPHONE NUMBERS ARE TO BE VERIFIED PRIOR TO SITE ACTIVITIES

E. EMERGENCY INFORMATION\*

Local Resources

(To be determined prior to on-site activity)

Ambulance Zionville (317) 873-3363

Hospital Emergency Room St. Vincents Hospital, 2001 W. 86th St. (317) 871-2121

Poison Control Center Methodist Hosp. of Indiana, 1604 N. Capitol St. Indianapolis  
1-800-382-9093

Police Zionville (317) 873-2233

Fire Department Zionville (317) 873-3344

Airport Boone County Airport, 1600 E. 250th St., South Lebanon (317) 873-4523

Explosives Unit \_\_\_\_\_

EPA Contact \_\_\_\_\_

Site Resources

Water Supply To be brought to the site

Telephone \_\_\_\_\_

Radio \_\_\_\_\_

Other \_\_\_\_\_

Emergency Contacts

1. Mr. Raymond Harbison (University of Arkansas) ..... (501) 661-5766 or 661-5767  
(501) 370-8263 (24 hour)
2. Ecology and Environment, Inc., Safety Coordinator/  
D. Dahlstrom ..... (716) 632-4491 (office)  
(716) 741-2384 (home)
3. Zone Project Management Office (CH2M Hill) ..... (703) 620-5200 (office)
4. Regional Project Team Leader/Manager
5. Regional Project Team Office
6. Ecology and Environment, Inc., AZPMO ..... (703) 522-6065
7. Regional Health Maintenance Program Contact
8. Ecology and Environment, Inc., 24-hour Emergency No. .... (716) 631-9530

\*EMERGENCY ROUTES ARE TO BE DRIVEN BY CH2M HILL PERSONNEL PRIOR TO SITE ACTIVITIES

F. EMERGENCY ROUTES\*

(Give road or other directions; attach map)

Hospital: Exit site and turn left onto Rt. 421 South. Continue south to W. 86 Street  
(2nd traffic light past I-465) turn left, hospital is on right 1 mile.

Other: This site safety plan was developed based upon the most recent and available  
information provided by CH2M Hill personnel. It is recognized that site conditions may  
have changed, therefore, it is imperative that the personnel protective measures be  
thoroughly assessed by the project team leader prior to and during the planned activities.  
This site safety plan was designed to cover that stated under objectives. Any other  
activities on or off-site will invalidate this safety plan and will require further  
approval by D. Dahlstrom prior to initiation.



---

#### G. GENERAL ASSUMPTIONS

1. This Site Safety Plan is based on research and investigatory data which may be dated or incomplete. Site conditions may have changed. Consequently, the Site Safety Coordinator is cautioned to bring any unusual or changed site conditions which are inconsistent with the Safety Plan or which raise health and safety issues that require additional input or support to the attention of Ecology and Environment, Inc. (E & E), Attn.: Dave Dahlstrom, (716) 632-4491 or CH2M Hill, Attn.: Mary Anne Chillingworth, as appropriate.
  2. The safety recommendations made in this plan assume (a) that all personnel on site have been determined by their employers and/or an authorized physician, to be in good mental and physical health, and able to perform anticipated tasks and react to emergency situations in a safe and appropriate manner; (b) that the company employing personnel subject to this safety plan has had its medical health and safety program approved by CH2M Hill and said program is designed to protect all employees who regularly work on hazardous material/waste projects; (c) that all personnel engaged in field activities subject to this safety plan have undergone training to an "intermediate level" or better, in an EPA-approved training program, in accordance with "EPA Guidelines for Hazardous Waste Investigations," Section 1440.2, and have appropriate experience in performing services in hazardous waste sites having both known and unknown waste characteristics; and (d) that any persons engaged in field activities subject to this safety plan are adequately trained in the testing and operation of recommended safety equipment.
  3. Should the work objective or scope of work for a particular field assignment specified in this safety plan be changed at any time prior to the completion of the specified field assignment, the terms of this plan must be reviewed and re-evaluated because of the possibility that the plan may be inappropriate for the changed circumstances. In the event such changes in scope or work objectives occur, it is understood that the site safety officer and the project manager have the responsibility to re-evaluate the appropriateness of the safety plan in light of the changes and request a new site safety plan. It is further understood that the initial site safety plan is not designed for activities that are inconsistent with the scope of work or work objectives of this plan and that any activities undertaken by a subcontractor to CH2M Hill under such circumstances without modifying the health and safety plan is performed at the sole risk of the subcontractor.
-

---

H. ACKNOWLEDGEMENT AND CERTIFICATION FOR SUBCONTRACTORS TO CH2M HILL

\_\_\_\_\_, the duly authorized Site Safety Coordinator and representative of the subcontractor to CH2M Hill, \_\_\_\_\_  
(Print Name)

(Name of Company)

("Company"), hereby acknowledges and certifies on behalf of Company and its employees, agents, and representatives that he/she

(i) has reviewed the foregoing Site Safety Plan, understands its requirements;

(ii) understands and accepts the duties and responsibilities imposed on the company and its employees by paragraph G;

(iii) agrees that all of Company's activities on site will be performed in accordance with this Plan's requirements and the requirements of any other federal, state, or local law, statute, ordinance, rule, or regulation governing Company's activities on site.

(iv) agrees that it retains primary responsibility for the oversight and implementation of medical surveillance and health and safety protocols governing field activities, and any information heretofore provided by Ecology and Environment, Inc. and/or CH2M Hill regarding such matters, including the safety plan for a particular site, is provided for limited purposes and serves only as a supplement to the health and safety programs and information made available by said company to its employees; and

(v) in all cases where the company is authorized to conduct field activities without the supervision of E & E and/or CH2M Hill, it agrees that any and all on-site or other activities conducted by CH2M Hill and or Ecology and Environment, Inc., in no way absolve, relieve, release or discharge company, its officers, agents, employees, and representatives from its responsibility, obligation, and duty to comply with all requirements of this Safety Plan, or any other federal, state, or local law, statute, ordinance, rule, or regulation governing Company's activities on site.


\_\_\_\_\_  
(Authorized Signature)

\_\_\_\_\_  
(Date)

---


FIGURE 1  
PLAN VIEW  
OF THE  
FACILITY


SCALE IN FEET





LEGEND

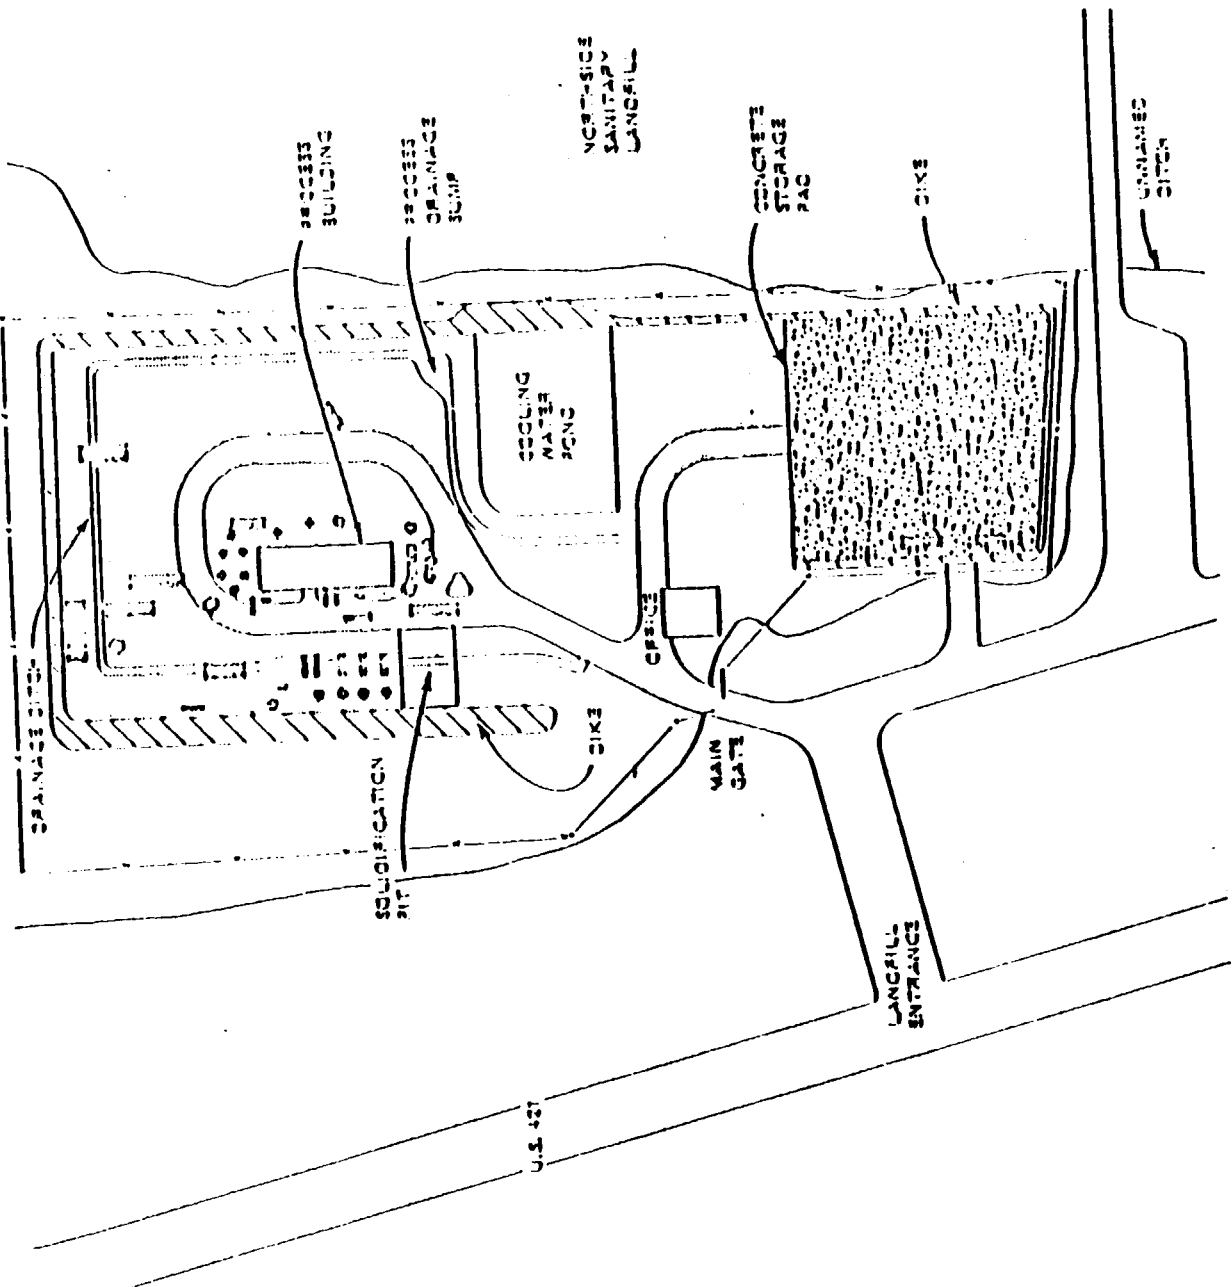CONCRETE STORAGE TANK	[Stippled rectangle]
CONCRETE BEIN' CONSTRUCTED	[Hatched rectangle]
CONCRETE DRAIN	[Solid line]
SEWER TANK	[Circle with cross]
SEWER TREATMENT TANK	[Circle with dots]
SEWER	[Dashed line]

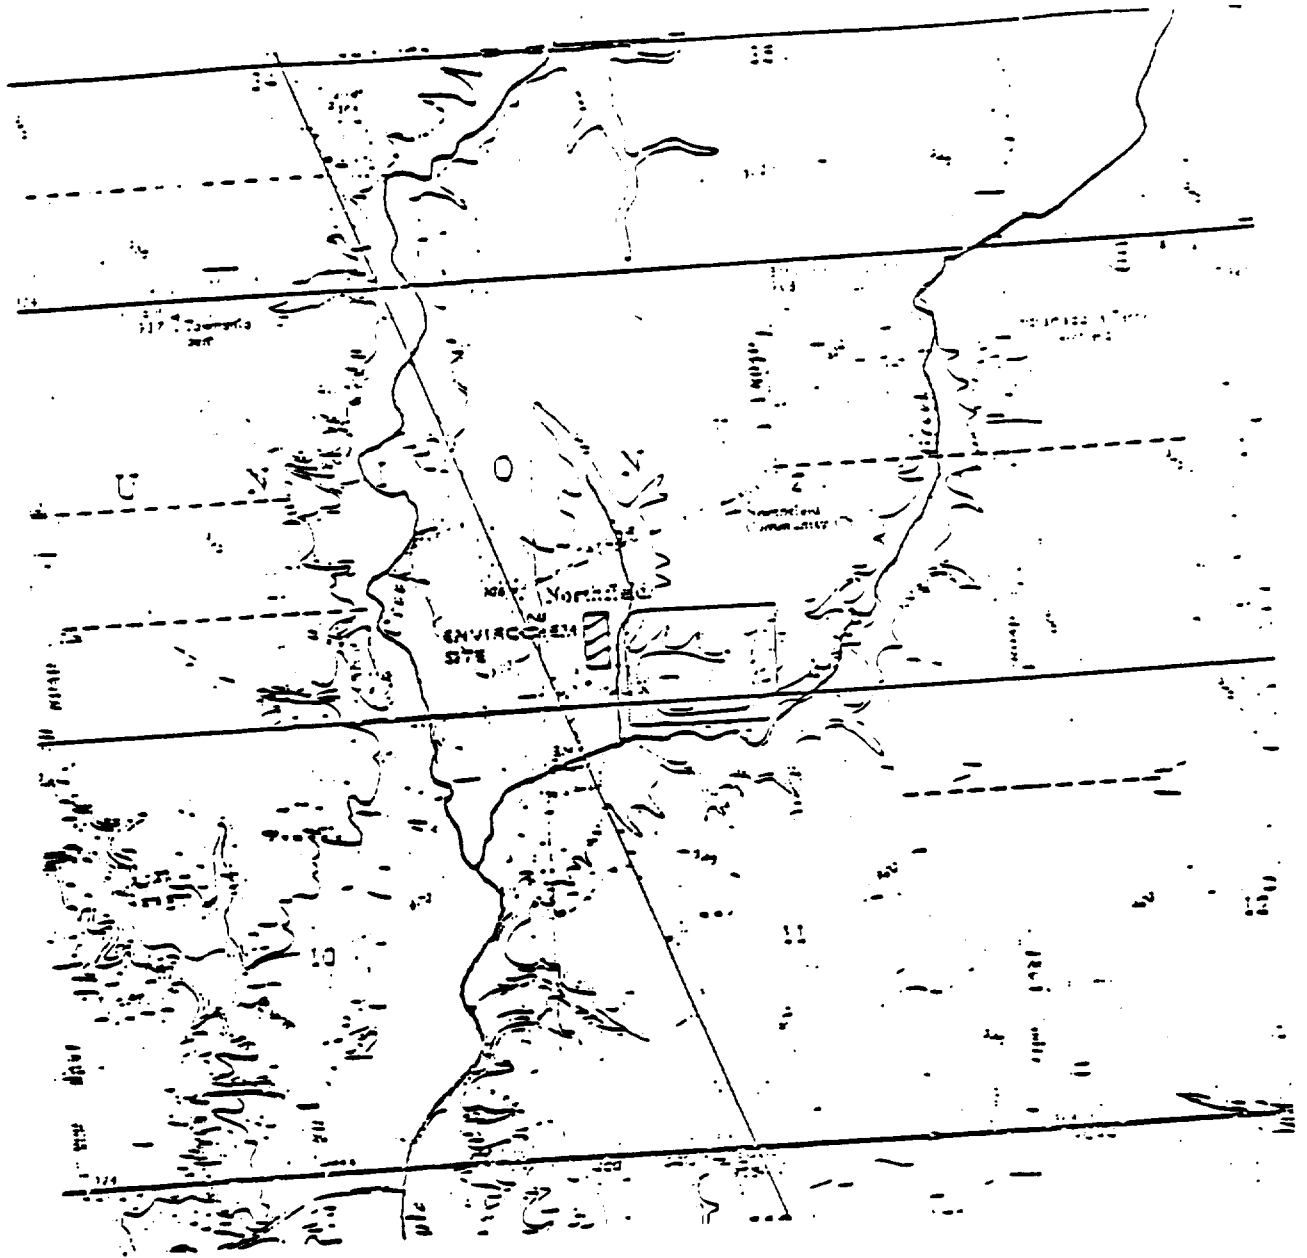



LEGEND

-  NORTH SIDE LANDFILL
-  ENVIRONMENTAL SITE





FIGURE 2-2  
VICINITY MAP  
OF SITE

66  
67  
68  
69  
70  
71  
72  
73  
74  
75  
76  
77  
78  
79  
80  
81  
82  
83  
84  
85  
86  
87  
88  
89  
90  
91  
92  
93  
94  
95  
96  
97  
98  
99  
100  
101  
102  
103  
104  
105  
106  
107  
108  
109  
110  
111  
112  
113  
114  
115  
116  
117  
118  
119  
120  
121  
122  
123  
124  
125  
126  
127  
128  
129  
130  
131  
132  
133  
134  
135  
136  
137  
138  
139  
140  
141  
142  
143  
144  
145  
146  
147  
148  
149  
150  
151  
152  
153  
154  
155  
156  
157  
158  
159  
160  
161  
162  
163  
164  
165  
166  
167  
168  
169  
170  
171  
172  
173  
174  
175  
176  
177  
178  
179  
180  
181  
182  
183  
184  
185  
186  
187  
188  
189  
190  
191  
192  
193  
194  
195  
196  
197  
198  
199  
200  
201  
202  
203  
204  
205  
206  
207  
208  
209  
210  
211  
212  
213  
214  
215  
216  
217  
218  
219  
220  
221  
222  
223  
224  
225  
226  
227  
228  
229  
230  
231  
232  
233  
234  
235  
236  
237  
238  
239  
240  
241  
242  
243  
244  
245  
246  
247  
248  
249  
250  
251  
252  
253  
254  
255  
256  
257  
258  
259  
260  
261  
262  
263  
264  
265  
266  
267  
268  
269  
270  
271  
272  
273  
274  
275  
276  
277  
278  
279  
280  
281  
282  
283  
284  
285  
286  
287  
288  
289  
290  
291  
292  
293  
294  
295  
296  
297  
298  
299  
300  
301  
302  
303  
304  
305  
306  
307  
308  
309  
310  
311  
312  
313  
314  
315  
316  
317  
318  
319  
320  
321  
322  
323  
324  
325  
326  
327  
328  
329  
330  
331  
332  
333  
334  
335  
336  
337  
338  
339  
340  
341  
342  
343  
344  
345  
346  
347  
348  
349  
350  
351  
352  
353  
354  
355  
356  
357  
358  
359  
360  
361  
362  
363  
364  
365  
366  
367  
368  
369  
370  
371  
372  
373  
374  
375  
376  
377  
378  
379  
380  
381  
382  
383  
384  
385  
386  
387  
388  
389  
390  
391  
392  
393  
394  
395  
396  
397  
398  
399  
400  
401  
402  
403  
404  
405  
406  
407  
408  
409  
410  
411  
412  
413  
414  
415  
416  
417  
418  
419  
420  
421  
422  
423  
424  
425  
426  
427  
428  
429  
430  
431  
432  
433  
434  
435  
436  
437  
438  
439  
440  
441  
442  
443  
444  
445  
446  
447  
448  
449  
450  
451  
452  
453  
454  
455  
456  
457  
458  
459  
460  
461  
462  
463  
464  
465  
466  
467  
468  
469  
470  
471  
472  
473  
474  
475  
476  
477  
478  
479  
480  
481  
482  
483  
484  
485  
486  
487  
488  
489  
490  
491  
492  
493  
494  
495  
496  
497  
498  
499  
500  
501  
502  
503  
504  
505  
506  
507  
508  
509  
510  
511  
512  
513  
514  
515  
516  
517  
518  
519  
520  
521  
522  
523  
524  
525  
526  
527  
528  
529  
530  
531  
532  
533  
534  
535  
536  
537  
538  
539  
540  
541  
542  
543  
544  
545  
546  
547  
548  
549  
550  
551  
552  
553  
554  
555  
556  
557  
558  
559  
560  
561  
562  
563  
564  
565  
566  
567  
568  
569  
570  
571  
572  
573  
574  
575  
576  
577  
578  
579  
580  
581  
582  
583  
584  
585  
586  
587  
588  
589  
590  
591  
592  
593  
594  
595  
596  
597  
598  
599  
600  
601  
602  
603  
604  
605  
606  
607  
608  
609  
610  
611  
612  
613  
614  
615  
616  
617  
618  
619  
620  
621  
622  
623  
624  
625  
626  
627  
628  
629  
630  
631  
632  
633  
634  
635  
636  
637  
638  
639  
640  
641  
642  
643  
644  
645  
646  
647  
648  
649  
650  
651  
652  
653  
654  
655  
656  
657  
658  
659  
660  
661  
662  
663  
664  
665  
666  
667  
668  
669  
670  
671  
672  
673  
674  
675  
676  
677  
678  
679  
680  
681  
682  
683  
684  
685  
686  
687  
688  
689  
690  
691  
692  
693  
694  
695  
696  
697  
698  
699  
700  
701  
702  
703  
704  
705  
706  
707  
708  
709  
710  
711  
712  
713  
714  
715  
716  
717  
718  
719  
720  
721  
722  
723  
724  
725  
726  
727  
728  
729  
730  
731  
732  
733  
734  
735  
736  
737  
738  
739  
740  
741  
742  
743  
744  
745  
746  
747  
748  
749  
750  
751  
752  
753  
754  
755  
756  
757  
758  
759  
760  
761  
762  
763  
764  
765  
766  
767  
768  
769  
770  
771  
772  
773  
774  
775  
776  
777  
778  
779  
780  
781  
782  
783  
784  
785  
786  
787  
788  
789  
790  
791  
792  
793  
794  
795  
796  
797  
798  
799  
800  
801  
802  
803  
804  
805  
806  
807  
808  
809  
810  
811  
812  
813  
814  
815  
816  
817  
818  
819  
820  
821  
822  
823  
824  
825  
826  
827  
828  
829  
830  
831  
832  
833  
834  
835  
836  
837  
838  
839  
840  
841  
842  
843  
844  
845  
846  
847  
848  
849  
850  
851  
852  
853  
854  
855  
856  
857  
858  
859  
860  
861  
862  
863  
864  
865  
866  
867  
868  
869  
870  
871  
872  
873  
874  
875  
876  
877  
878  
879  
880  
881  
882  
883  
884  
885  
886  
887  
888  
889  
890  
891



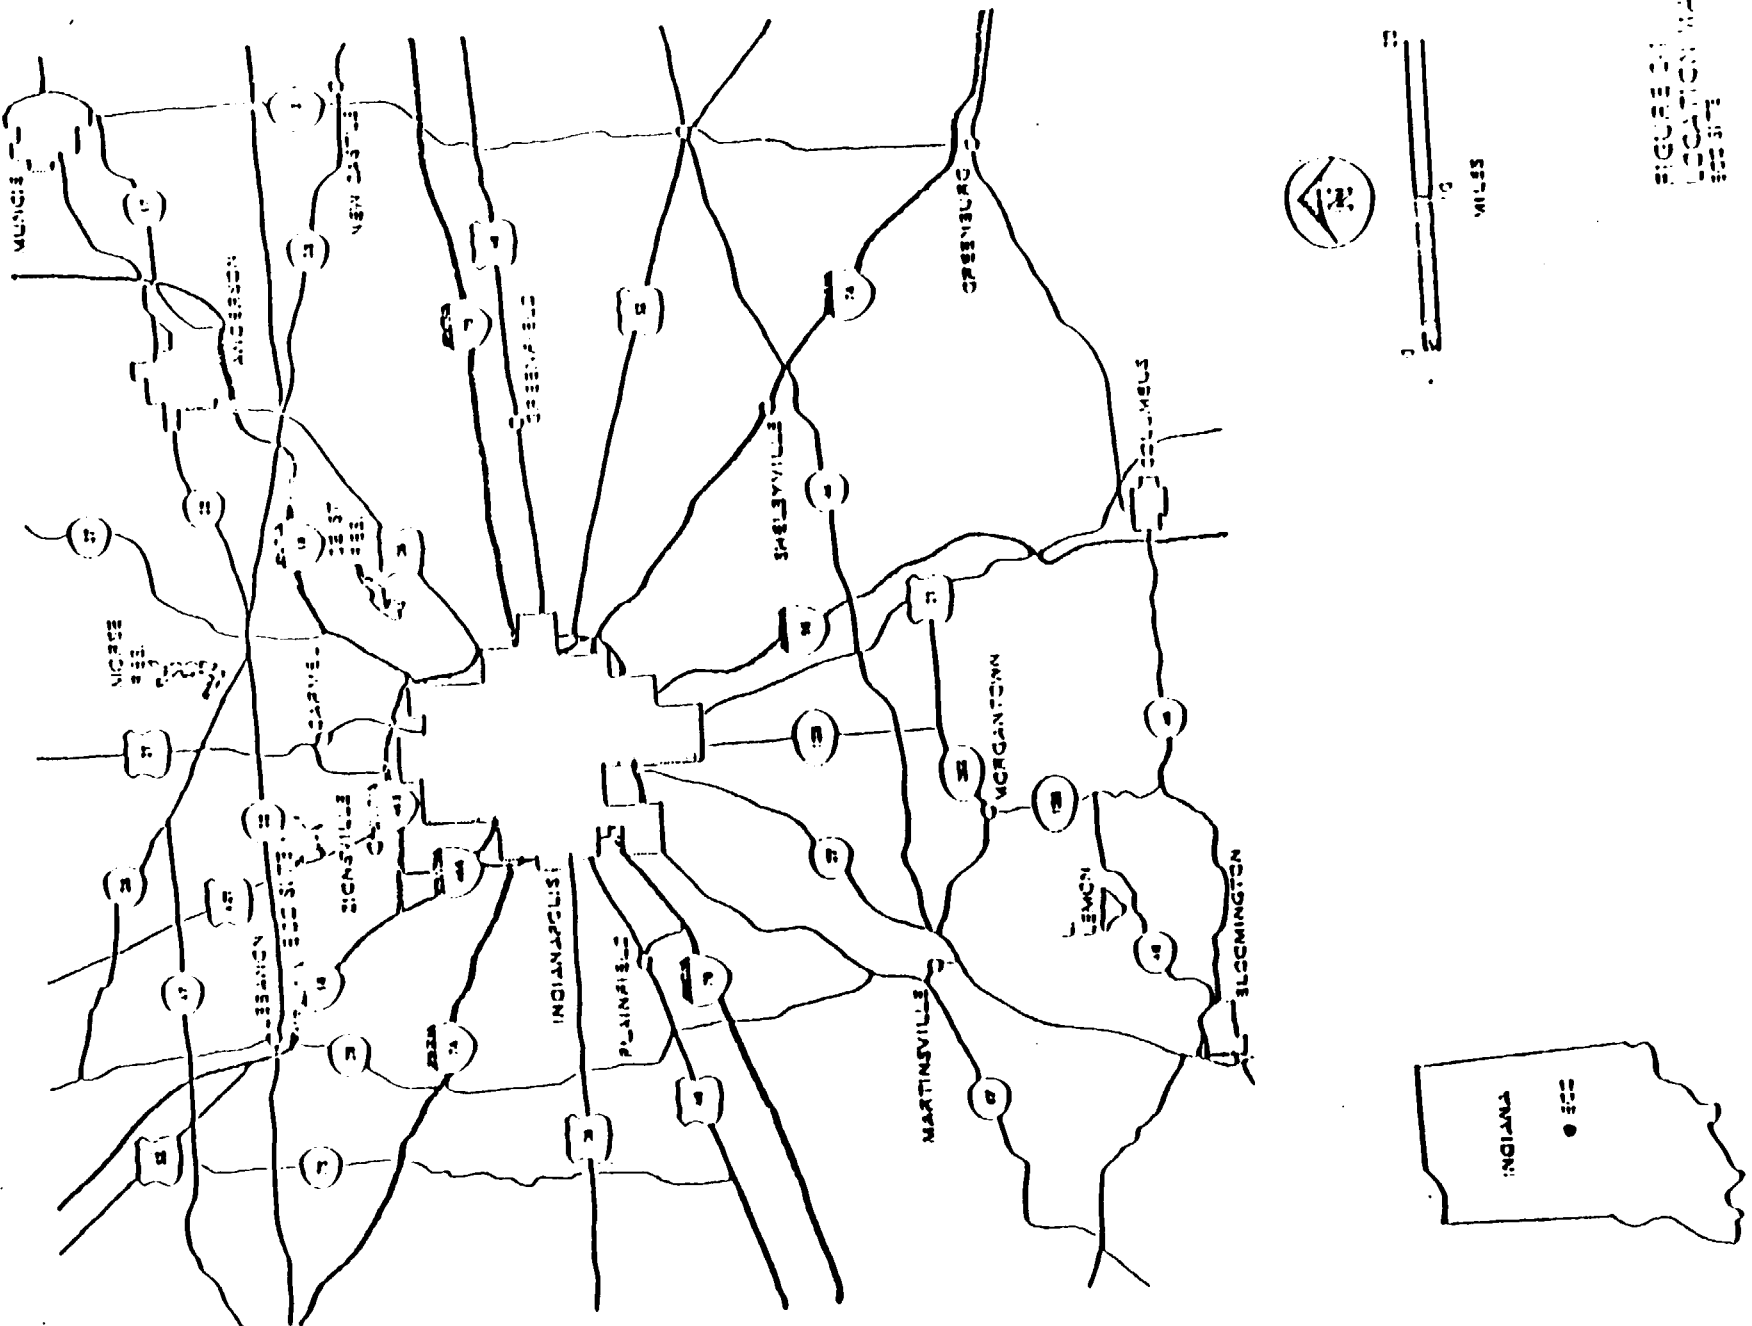

Section 6

## SOIL SAMPLING TRIP INSTRUCTIONS

### A. PERSONNEL

### ASSIGNMENT

Pete Gorton - E&E	OVA operator
Russ Short - E&E	Site safety coor.
Dennis Totzke	Proj. mgr.; sampler
Ike Johnson	Sample team leader 1
Brad Berggren	Sample team leader 2
Randy Weltzin	Sampler, surveyor
Mark Lepkowski	Decon. tech, sampler, paperwork coor.

### B. SITE DATA

**Location:** Approximately 10 miles north of Indianapolis, Indiana, near Zionsville, Indiana.

**Telephones:** EPA Trailer: 317-769-4482  
Chem Waste Trailer: 317-769-4484

**Site Conditions:** Much better!! All drums gone; all bulk liquids gone; all portable bulk tanks gone; contaminated lagoon water gone; so why are we going? Dirty dirt!!  
Background readings: 5-30 ppm (OVA)

**Lodgings:** Individual rooms at Red Roof Inn (North) just off US 421 (317-872-3030) near Zionsville.

### C. TENTATIVE SCHEDULE

<u>Date</u>	<u>Time</u>	<u>Activity</u>
5/6	3 p.m.	Leave Milwaukee; drive to Indianapolis. Dennis Totzke to pick up Brad Berggren and Mark Lepkowski; Isaac Johnson to pick up Randy Weltzin.

<u>Date</u>	<u>Time</u>	<u>Activity</u>
5/7	7 a.m.-noon	Arrive at site and set up decon. Calibrate instruments. Determine background conditions. Establish command post. Stake sample locations and check for buried drums and tanks. Obtain supplies. Get what we forgot.
	1 p.m.-7 p.m.	Begin sampling.
5/8	7 a.m.-noon	Sampling.
	1 p.m.-7 p.m.	Sampling.
5/9	7 a.m.-noon	Sampling.
	1 p.m.-7 p.m.	Sampling.
5/10	7 a.m.-noon	Sampling.
	1 p.m.-7 p.m.	Sampling.
5/11	7 a.m.-noon	Shut down, pack up and move out.
	noon-6 p.m.	Drive back to Milwaukee.

D. EQUIPMENT

OVA's - 2  
 OVA recorder - 1  
 HNU - 1  
 O<sub>2</sub>/explosimeter - 1  
 Rad mini - 2  
 Dosimeter - 1 per person  
 SCBA (standby) - 1  
 Hand augers - 4  
 Auger extensions - 2  
 Walkie talkies - 3  
 Surveying equipment - 1 set  
 Decon. equipment - 1 hot line setup  
 Decon. equipment - 1 borehole setup  
 Plastic pails - 10  
 Tyveks - 100  
 Respirator cartridges - 160  
 Booties - 100 pair  
 Gloves, rubber - 6 pair  
 Gloves, surgeon - 100 pair

E. OBJECTIVES

- o To use borehole monitoring and OVA survey analysis techniques to define gross total volatile organic contamination boundaries on the site (see sampling study plan)

- o To delineate horizontal and vertical limits of contaminated soils so that the cleanup contractor can remove 4300 yds<sup>3</sup> of material
- o To determine the approximate depth of contamination in the polymer pit
- o To determine approximate depth and degree of contamination of cooling water pond sediments
- o To accomplish the work safely and expeditiously (i.e., we don't have a lot of time or an expandable budget)
- o To send about 35 soil/sediment samples to the CLP for analysis (samples will be sent after we return from the sampling trip)

GLT90/45